



# Tech Info Library

## Apple IIGS: Error 0C Indicates Sound Chip Problem

Revised: 6/6/91  
Security: Everyone

Apple IIGS: Error 0C Indicates Sound Chip Problem

=====

Article Created: 14 April 1991  
Article Last Reviewed:  
Article Last Updated:

TOPIC -----

My Apple IIGS (rev. 03 ROM) gives a self test error code of 0C000004, though everything seems to be working fine. What does this code mean?

DISCUSSION -----

Apple IIGS Tech Note #95 explains the diagnostics test:

AA = 0C  
DD = 01: RAM data error  
      02: RAM address error  
      03: Data register failed  
      04: Control register failed  
      05: Oscillator interrupt timeout

In your case, the problem is a control register failure, specifically a bad sound chip. Since the sound chip is not socketed, you will have to replace the logic board of the Apple IIGS.

Copyright 1991 Apple Computer, Inc.

Tech Info Library Article Number:7260